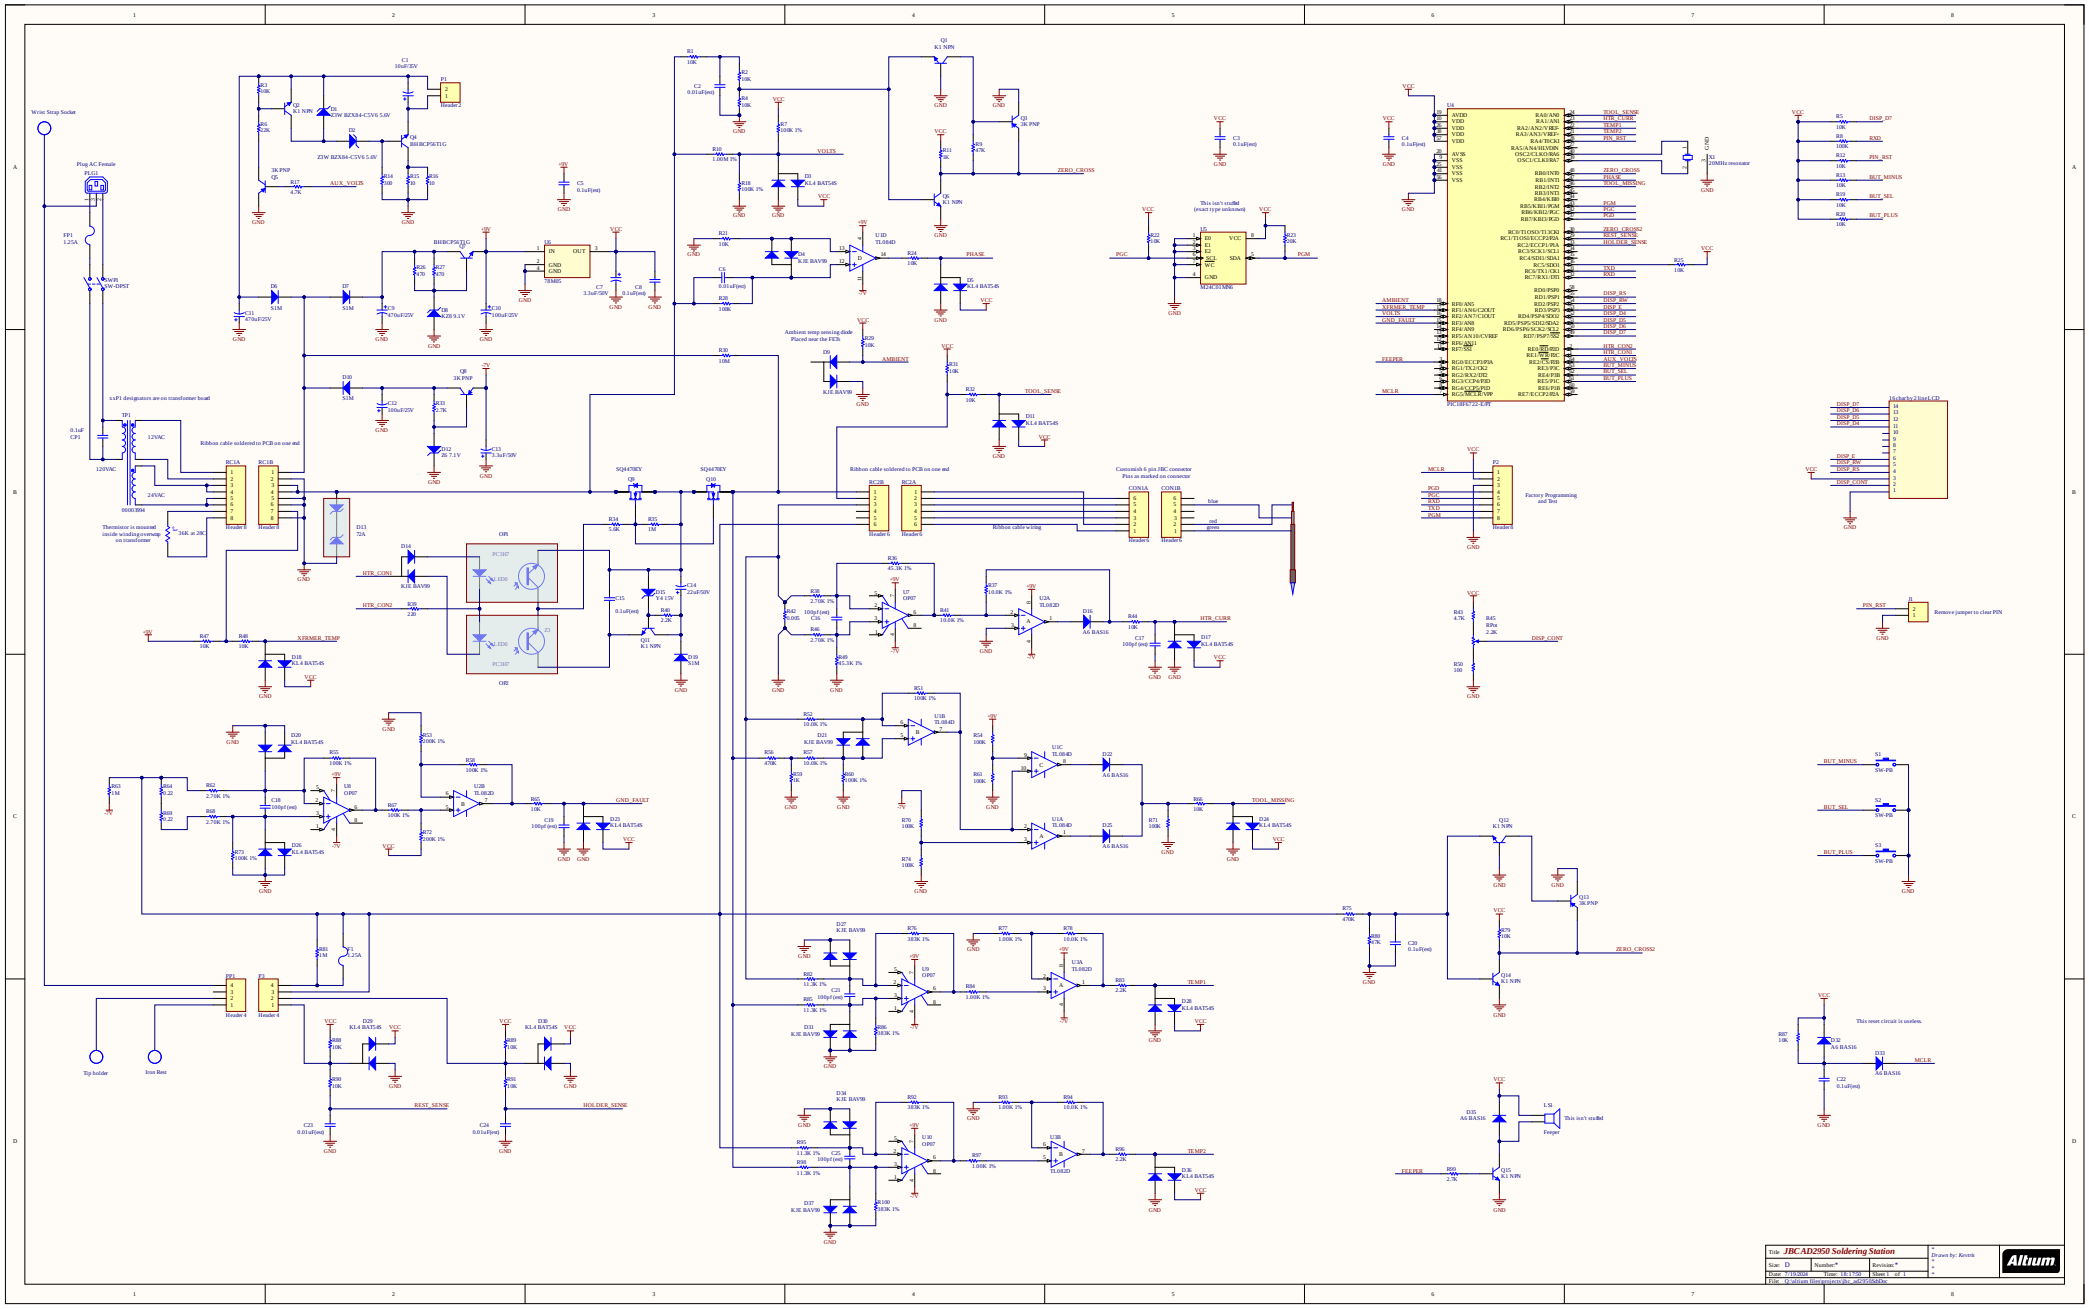
Wrist Strap Socket
Plug AC Female
PLG1
FP1 1.25A
SW1 SW-DPST
120VAC
240VAC
Thermistor is mounted inside winding overside on transformer
Ribbon cable soldered to PCB on one end
Header 8
Header 6
Header 4
Tip holder
Iron Rest
REST_SENSE
HOLDER_SENSE
HTR_CON1
HTR_CON2
XFRMER_TEMP
GND_FAULT
VOLTS
AUX_VOLTS
PHASE
ZERO_CROSS
AMBIENT
TOOL_SENSE
TOOL_MISSING
ZERO_CROSS2
TEMP1
TEMP2
HTR_CURR
DISP_CONT
PGC
PGD
MCLR
FEEDER
Factory Programming and Test
Remove jumper to clear PIN
This reset circuit is useless.
This isn't stuffed
Feeder
Title: JBC AD2950 Soldering Station
Size: D
Number:*
Revision:*
Date: 7/19/2004
Time: 18:17:28
Sheet 1 of 1
File: Q:\altium library\projects\jbc_ad2950.SchDoc
Drawn by: Kevin
Altium